

## BOURGAULT MARKETING - TECHNICAL SERVICE BULLETIN

**TSB # 26-2021** October 27, 2021 Page 1 of 2

TO:


ATTN:

SUBJECT: Hydraulic Changes on Bourgault Independent Opener Drills (3330, 3335, 3820, 3720)

## **INFORMATION BULLETIN:**

A couple recent changes to the hydraulic circuits on Bourgault independent opener drills has resulted in a very significant operational change.

On all model year 2022 drills the openers will no longer raise or lower by simply cycling the opener depth control circuit on the tractor. When these machines are NOT connected to a 410 control box or X30/X35 controller the ONLY way to raise or lower the openers will be to use the manual override on the directional control valve.

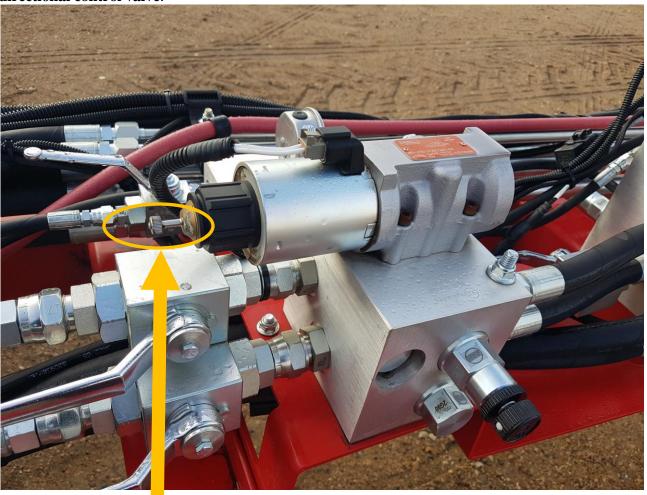


Manual Override Screw



A running change will take effect shortly to install an updated tag (part number 3903-98-29) to the directional control valve – which will provide clear instructions.



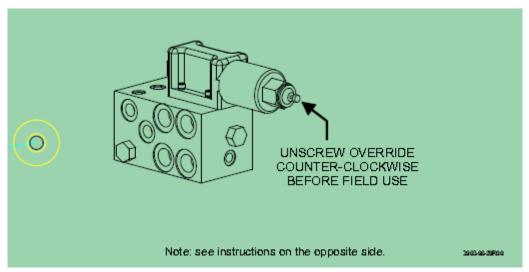

It is important that new owners of these model year 2022 drills are made aware of this important operational change.

If you have any questions regarding this TSB please contact your local Bourgault dealer